Technical Bulletin



Number: 2050017

Cleaning the 2,000 Watt Inverter Pilot Jet

This bulletin covers the following Champion Power Equipment models:

All 2,000 Watt Inverter Models

Note: Read instructions completely before performing service.


1. Remove the Phillips head screw holding the black pilot jet capture plate by going through the access hole in the stepper motor support plate. Remove the capture plate as well.



2. Using a small pocket screwdriver, lift the pilot jet an 1/8th of an inch in order to grab the jet with a pair of needle nose pliers. Use these to remove the jet from the carburetor.



3. Using a strand of copper wire small enough to fit through the hole, clean the jet passage way. Then spray through the jet with carburetor or brake cleaner and then compressed air if available.

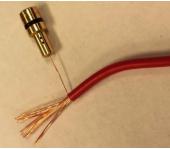



Technical Bulletin Number: 2050017

4. Reinstall pilot jet making sure the groove on top of the jet is inline with the airflow.



5. Reinstall pilot jet capture plate and Phillips head screw.

If you have any questions, please contact Champion Power Equipment:

Champion Power Equipment, Inc. 12039 Smith Ave. Santa Fe Springs, CA 90670

Phone: 1-877-338-0999

Email: tech@championpowerequipment.com